



## Aspen Field Services

Job #: 59629 /

VIN: JALE5W165L7301242

# 16' MORGAN DRY VAN BODY WITH WALKRAMP, DIESEL 2020 ISUZU NRR - LA130348 / LA130348 VINTAGE IMPORTS

Specifications	
Year	2020
Make	Isuzu
Model	NRR
Date of Inspection	08/31/2023
Location of Inspection	7777 Essington Ave, Philadelphia, PA, 19153
VIN	JALE5W165L7301242
GVWR	19,500 lbs
Odometer	163,000
Engine Hours	5,892
EMS Warning Lights	No Active Warnings
Cab Interior	No Damages Observed
Driver's Seat	See Notes
Passenger's Seat	See Notes
Transmission Type	Automatic
Pedals	No Damages Observed
Floorboard	See Notes
Radio	Yes
A/C	Yes
Switches and Controls	No Damages Observed
Power Mirrors	No
Heated Mirrors	Yes
Steering Wheel	No Damages Observed
Mirrors	No Damages Observed
Steps	No Damages Observed
Handrails	See Notes
Exhaust Pipe	Single - No Damages Observed
Engine Compartment	See Notes
Oil Dipstick	Good Level / Dark In Color
Coolant Level	Low Level
Suspension	Leaf Spring - No Damages Observed
Axles	No Damages Observed
Front Lights	No Damages Observed
Rear Lights	See Notes
Left Steer Tire Condition	No Damages Observed
Left Steer Tire Brand	Hercules
Left Steer Tire Size	225/70R19.5
Rear Left Outer Drive Tire Condition	No Damages Observed
Rear Left Outer Drive Tire Brand	Ironman
Rear Left Outer Drive Tire Size	225/70R19.5

## Equipment Photo



## Video Inspection Link

<https://app.aspenfieldservices.com/jobs/video/QXCPsvRj9pN2Bs4QC>

## Notes / Description

The Engine Information was obtained from a VIN-Decoding software.



## Aspen Field Services

Job #: 59629 /

VIN: JALE5W165L7301242

Rear Left Inner Drive Tire Condition	No Damages Observed
Right Steer Tire Condition	No Damages Observed
Right Steer Tire Brand	Hercules
Right Steer Tire Size	225/70R19.5
Rear Right Outer Drive Tire Condition	No Damages Observed
Rear Right Outer Drive Tire Brand	Ironman
Rear Right Outer Drive Tire Size	225/70R19.5
Rear Right Inner Drive Tire Condition	No Damages Observed
Axle Information	GAWR F: 7,275 lbs / R: 13,660 lbs
Transmission Information	Could Not Be Located
Engine Information	5.2L Isuzu In-Line 4HK1-TC

Visible Damages	
Front Bumper	The front bumper is dented on the right side.
Clearance Light	The rear top clearance light lens in the center is broken.
Rear Bumper	The rear bumper is bent.
Grab Iron	The rear left grab iron is bent.
Floor Mat	The rubber floor mat is worn on the driver's side.
Driver's Seat	The driver's bottom seat cushion has holes in it.
Passenger's Seat	The passenger's bottom seat cushion is stained.
Windshield	The glass has a rock chip on the right side.
Plywood	The plywood panels in the box are damaged.
Coolant	The coolant is low in the reservoir.
Engine Oil	The engine oil is dark in color.
Rear Right Outer Wheel	The wheel is damaged around the lip.
Rear Differential	The differential is leaking.
Engine Bay Leak	There is an oil spot on the ground under the unit.
Sheet Metal Panels	There is a couple of panels damaged on the box.

# Aspen Field Services



Front Left / 08-31-2023



Front Right / 08-31-2023

# Aspen Field Services



Rear Left / 08-31-2023



Rear Right / 08-31-2023

# Aspen Field Services



Right / 08-31-2023




Front / 08-31-2023

# Aspen Field Services



Rear / 08-31-2023

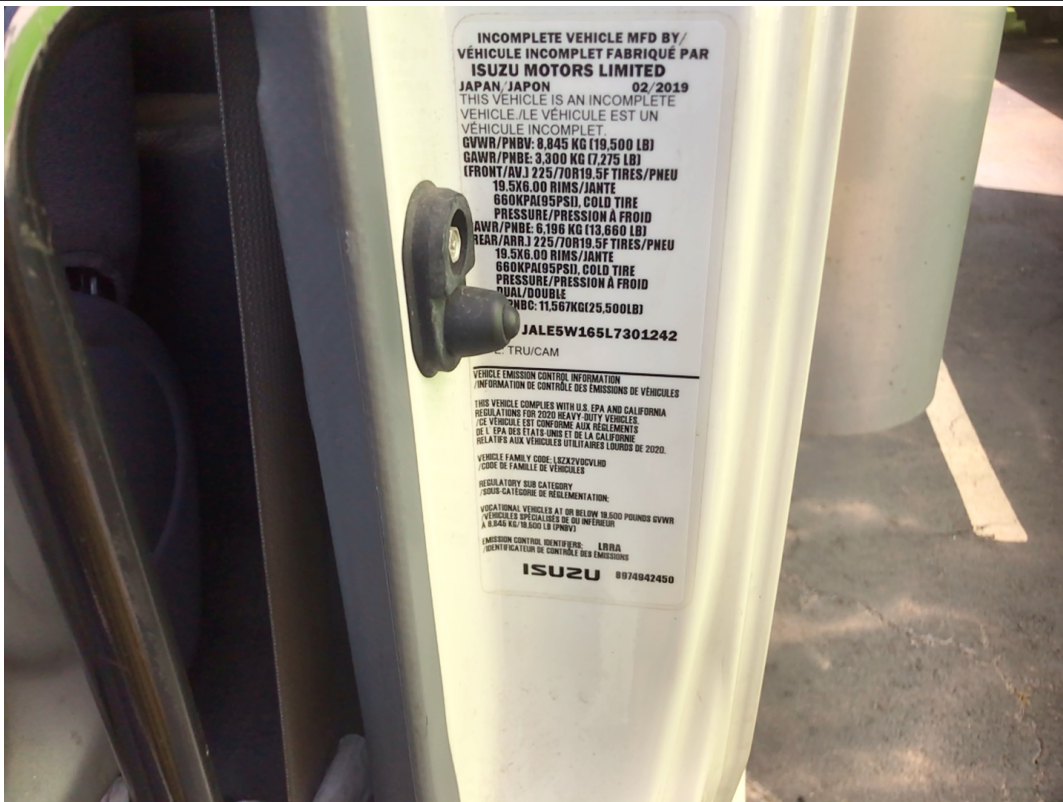

VIN: JALE5W165L7301242 / GVWR: 19,500 lbs / Axle Information / 08-31-2023

# Aspen Field Services



Odometer: 163,000 / 08-31-2023



Engine Hours: 5,892 / 08-31-2023

# Aspen Field Services



EMS Warning Lights / 08-31-2023



Cab Interior / 08-31-2023

# Aspen Field Services



Floorboard / 08-31-2023



Pedals / 08-31-2023

# Aspen Field Services



Driver's Seat / 08-31-2023



Switches and Controls / 08-31-2023

# Aspen Field Services



Switches and Controls / 08-31-2023



Steering Wheel / 08-31-2023

# Aspen Field Services



Switches and Controls / Radio / A/C / Heated Mirrors / 08-31-2023



Transmission / 08-31-2023

# Aspen Field Services



Floorboard / 08-31-2023



Passenger's Seat / 08-31-2023

Steps / 08-31-2023



Handrails / 08-31-2023

# Aspen Field Services



Handrails / 08-31-2023



Handrails / 08-31-2023

## A photograph taken from the perspective of someone inside a vehicle, looking out through the side-view mirror. The mirror is in the foreground, showing a reflection of the vehicle's side and a person holding a camera. In the background, there is a large white commercial building with several signs. One sign says "ISUZU TRUCK" in red. Another sign says "TRUCKS" with a red arrow pointing right. A third sign says "SALES" with a red arrow pointing left. A white Isuzu truck is parked in front of the building. The sky is blue with some clouds. The ground is paved asphalt.

Mirrors / 08-31-2023
----------------------



Handrails / 08-31-2023
------------------------

# Aspen Field Services



Handrails / 08-31-2023



Handrails / 08-31-2023

# Aspen Field Services



Steps / 08-31-2023



Mirrors / 08-31-2023

# Aspen Field Services




Exhaust Pipe / 08-31-2023



Box Interior / 08-31-2023

# Aspen Field Services

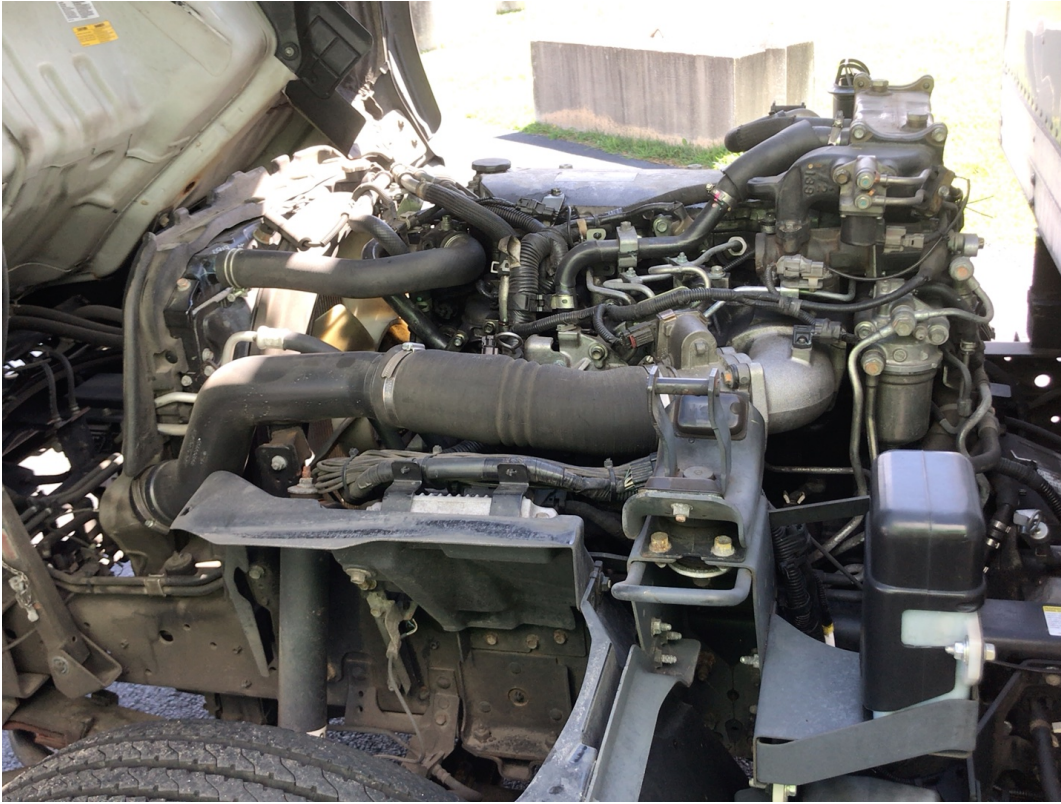

Engine Compartment / 08-31-2023




Engine Compartment / 08-31-2023

# Aspen Field Services



Coolant Level / 08-31-2023

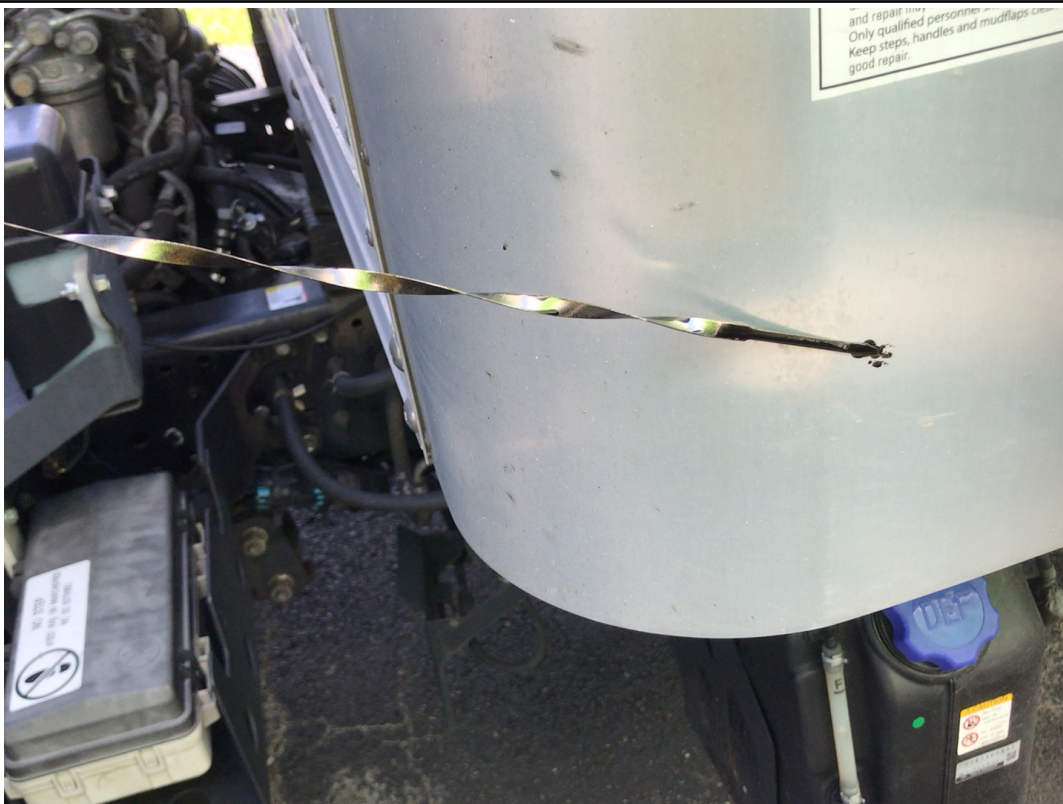

Oil Dipstick / 08-31-2023

# Aspen Field Services



Front Lights / 08-31-2023



Rear Lights / 08-31-2023

# Aspen Field Services



Left Steer Tire Condition / 08-31-2023



Left Steer Tire Brand / 08-31-2023

# Aspen Field Services



Left Steer Tire Condition / 08-31-2023



Left Steer Tire Size / 08-31-2023

# Aspen Field Services



Axles / Suspension / 08-31-2023



Right Steer Tire Condition / 08-31-2023

# Aspen Field Services



Right Steer Tire Condition / 08-31-2023



Axles / Suspension / 08-31-2023

# Aspen Field Services



Right Steer Tire Brand / 08-31-2023



Right Steer Tire Size / 08-31-2023

## Aspen Field Services



Rear Right Outer Drive Tire Condition / 08-31-2023



Rear Right Outer Drive Tire Condition / Rear Right Inner Drive Tire Condition / 08-31-2023

# Aspen Field Services



Rear Right Outer Drive Tire Brand / 08-31-2023



Rear Right Outer Drive Tire Size / 08-31-2023

# Aspen Field Services



Axles / Suspension / 08-31-2023



Suspension / 08-31-2023

## Aspen Field Services



Rear Left Outer Drive Tire Condition / 08-31-2023



Rear Left Outer Drive Tire Condition / Rear Left Inner Drive Tire Condition / 08-31-2023

# Aspen Field Services



Rear Left Outer Drive Tire Brand / 08-31-2023



Rear Left Outer Drive Tire Size / 08-31-2023

# Aspen Field Services



Axles / Suspension / 08-31-2023



Suspension / 08-31-2023