



Aspen Field Services

Job #: 70816 /

VIN: JALC4W167J7K00999

MORGAN 18' VAN BODY, DIESEL 2018 - ISUZU NPR-XD / LA125721

Specifications

Year	2018
Make	Isuzu
Model	NPR-XD
Date of Inspection	04/24/2024
Location of Inspection	10774 NW 53rd Street , Sunrise, FL, 33351, USA
VIN	JALC4W167J7K00999
GVWR	16,000 lbs
Odometer	181,347
Engine Hours	N/A
EMS Warning Lights	1 Active Warning
Cab Interior	See Notes
Driver's Seat	See Notes
Passenger's Seat	No Damages Observed
Transmission Type	Automatic
Pedals	No Damages Observed
Floorboard	See Notes
Radio	Yes
A/C	Yes
Switches and Controls	No Damages Observed
Power Mirrors	No
Heated Mirrors	No
Steering Wheel	See Notes
Mirrors	No Damages Observed
Steps	No Damages Observed
Handrails	No Damages Observed
Exhaust Pipe	No Damages Observed
Engine Compartment	See Notes
Oil Dipstick	Dark Color / Good Level
Coolant Level	Good Level
Suspension	No Damages Observed
Axles	No Damages Observed
Front Lights	No Damages Observed
Rear Lights	See Notes
Left Steer Tire Condition	No Damages Observed
Left Steer Tire Brand	Arisun
Left Steer Tire Size	225/70R19.5
Left Outer Drive Tire Condition	No Damages Observed
Left Outer Drive Tire Brand	Zenna
Left Outer Drive Tire Size	225/70R19.5
Left Inner Drive Tire Condition	No Damages Observed

Equipment Photo



Video Inspection Link

<https://app.aspenfieldservices.com/jobs/video/zCcSqdLuYAnXF8wPz>

Notes / Description

The unit runs. The engine information was acquired via a VIN decoder software.



Aspen Field Services

Job #: 70816 /

VIN: JALC4W167J7K00999

Right Steer Tire Condition	No Damages Observed
Right Steer Tire Brand	Arisun
Right Steer Tire Size	225/70R19.5
Right Outer Drive Tire Condition	No Damages Observed
Right Outer Drive Tire Brand	Trazano
Right Outer Drive Tire Size	225/70R19.5
Right Inner Drive Tire Condition	See Notes
Axle Information	Front: 6,630 lbs / Rear: 11,020 lbs
Transmission Information	Could Not Be Located
Engine Information	5.2L

Visible Damages		All repairs done.
Driver's Seat	The bottom cushion is stained and may have holes in the material. The backrest may have stains on it.	
Driver's Door Panel	The door panel has scratches on it.	
Steering Wheel	The wheel material is worn.	
Windshield	The glass appears to have rock chips.	
Service Warning	The dash shows that a type of unit service is over due and needs to be performed.	
Rear Differential	The rear differential is oily on the front left side. May be leaking and needs to be resealed.	
Engine Oil	The engine oil is dark in color.	
Coolant Reservoir Cap	The cap is missing on the reservoir.	
Floor Mat	The rubber floor mat is worn on the passenger side.	
Right Inner Drive Tire	The tire has debris stuck in the inside shoulder of the tire.	
Sheet Metal Panels	There is a couple of sheet metal panels on the box are scratched and dented.	
Front grill	The grill is cracked on the front left side.	
Rear Bumper	The DOT tape on the bumper is worn off and bumper has overspray paint on it.	
Right Taillight	The tail light has over spray paint on the lens.	
Mud Flaps	The rear mud flaps are missing on both rear left and right sides.	

Aspen Field Services



Front Left / 04-24-2024



Front / Front Lights / 04-24-2024

Aspen Field Services



Front Right / 04-29-2024



Rear Right / 05-01-2024

Aspen Field Services



Rear / 05-01-2024



Rear Left / 05-01-2024

Aspen Field Services



VIN: JALC4W167J7K00999 / GVWR: 16,000 lbs / Axle Information / 04-24-2024



Cab Interior / Handrails / 04-24-2024

Aspen Field Services



Floorboard / Pedals / 04-24-2024



Steering Wheel / 04-24-2024

Aspen Field Services



Switches and Controls / 04-24-2024



Switches and Controls / 04-24-2024

Aspen Field Services



Switches and Controls / 04-24-2024



Transmission Shifter / A/C / Radio / 04-24-2024

Aspen Field Services



Cab Interior / 04-24-2024



Odometer: 181,347 / 04-24-2024

Aspen Field Services



EMS Warning Lights / 04-24-2024



Cab Interior / 04-24-2024

Aspen Field Services



Suspensions / Axles / 04-24-2024



Suspensions / 04-24-2024

Aspen Field Services



Engine Compartment / 04-24-2024




Engine Compartment / 04-24-2024

Aspen Field Services



Oil Dipstick / 04-24-2024

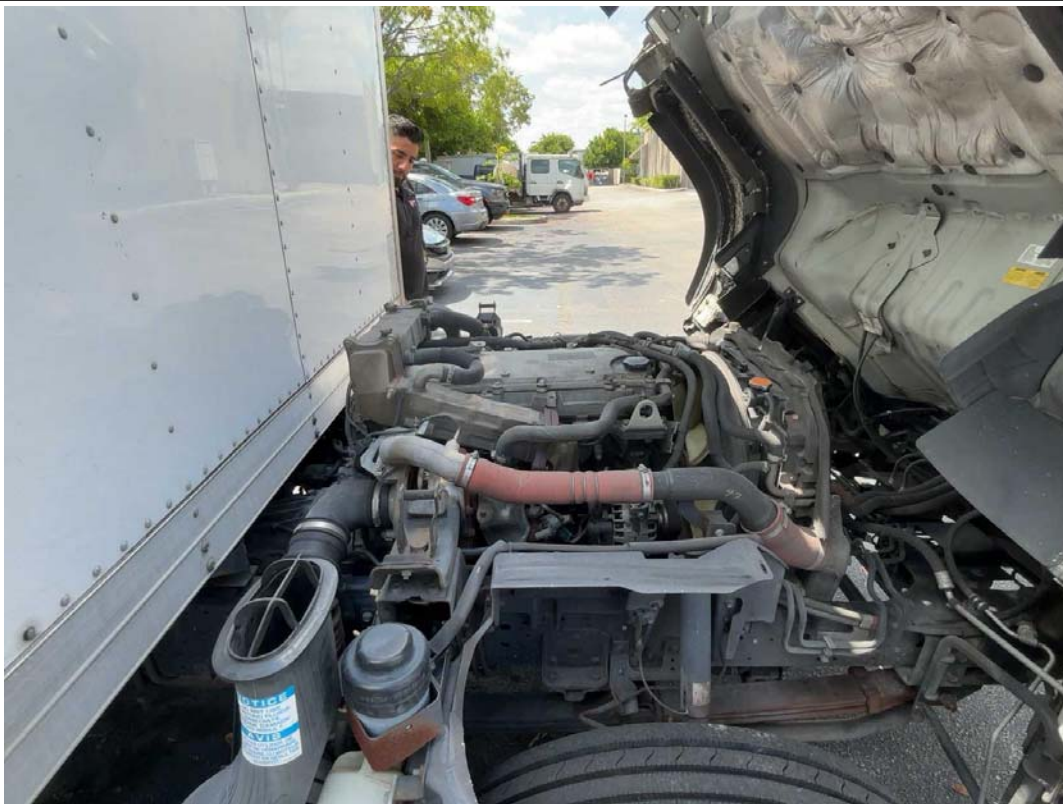


Engine Compartment / 04-24-2024

Aspen Field Services



Coolant Level / 04-24-2024

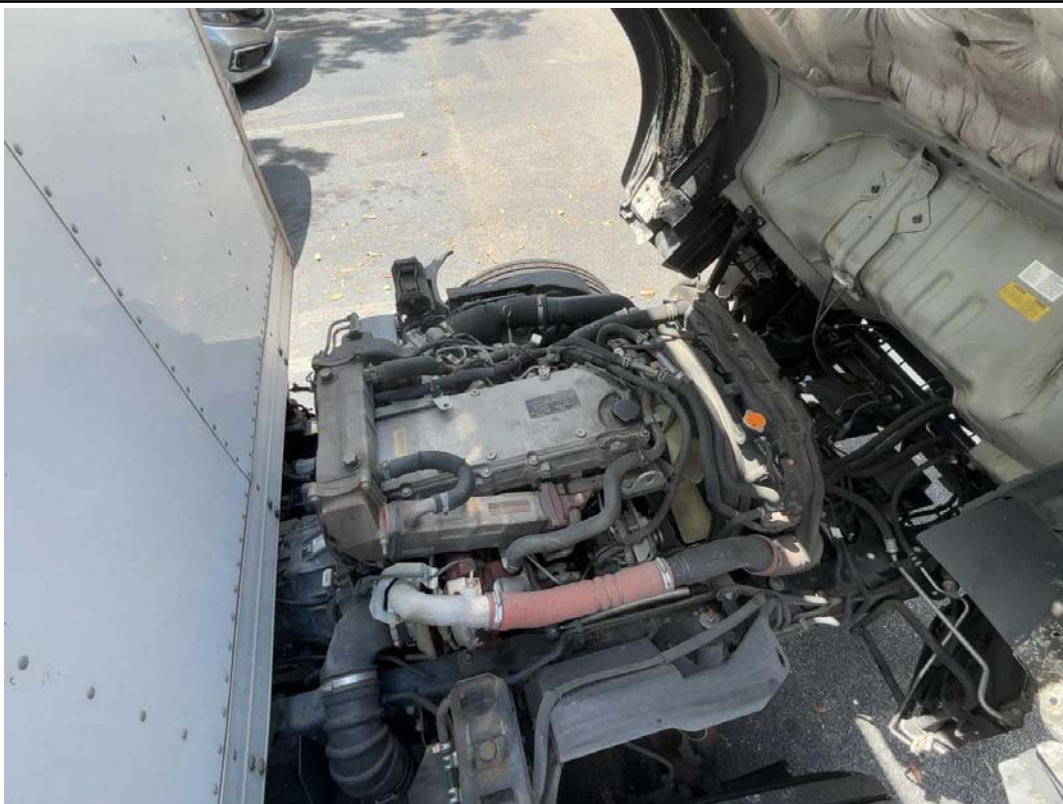

Engine Compartment / 04-24-2024

Aspen Field Services



Exhaust Pipe / 04-24-2024



Suspensions / Axles / 04-24-2024

Aspen Field Services



Suspensions / Axles / 04-24-2024



Exhaust Pipe / 04-24-2024

Aspen Field Services



Axles / Suspensions / 04-24-2024



Axles / 04-24-2024

Aspen Field Services



Suspensions / Axles / 04-24-2024



Box Interior / 04-24-2024

Aspen Field Services



Mirrors / 04-24-2024



Mirrors / 04-24-2024

Aspen Field Services



Steps / 04-24-2024



Steps / 04-24-2024

Aspen Field Services



Left Outer Drive Tire Condition / Left Inner Drive Tire Condition / 04-24-2024



Left Outer Drive Tire Condition / 04-24-2024

Aspen Field Services



Left Outer Drive Tire Brand / 04-24-2024



Left Outer Drive Tire Size / 04-24-2024

Aspen Field Services



Left Outer Drive Tire Condition / Left Inner Drive Tire Condition / 04-24-2024



Right Steer Tire Size / 04-25-2024

Aspen Field Services



Right Steer Tire Brand / 04-25-2024



Right Steer Tire Condition / 04-24-2024

Aspen Field Services



Right Steer Tire Condition / 04-24-2024



Right Outer Drive Tire Condition / Right Inner Drive Tire Condition / 04-24-2024

Aspen Field Services



Right Outer Drive Tire Brand / 04-24-2024



Right Outer Drive Tire Size / 04-24-2024

Aspen Field Services



Right Outer Drive Tire Condition / 04-24-2024



Left Steer Tire Size / 04-24-2024

Aspen Field Services



Left Steer Tire Brand / 04-24-2024



Left Steer Tire Condition / 04-24-2024